

© 2017 Mazda Motor of America, Inc.

Subject: SEAT BELT COMES OUT OF SEAT BELT GUIDE WHEN RETRACTING	Bulletin No: 08-001/17
	Last Issued: 01/03/2017

BULLETIN NOTE

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red beside the change bars.


Previous TSBs:	Issued Dates:
08-002/16	04/29/16

APPLICABLE MODEL(S)/VINS


2016 MX-5 vehicles with VINs lower than JM1ND*****108746 (produced before December 14, 2015)

DESCRIPTION

Some customers may complain that the seat belt comes out of the seat belt guide when the seat belt retracts as shown because the shape of the seat belt guide is inadequate.

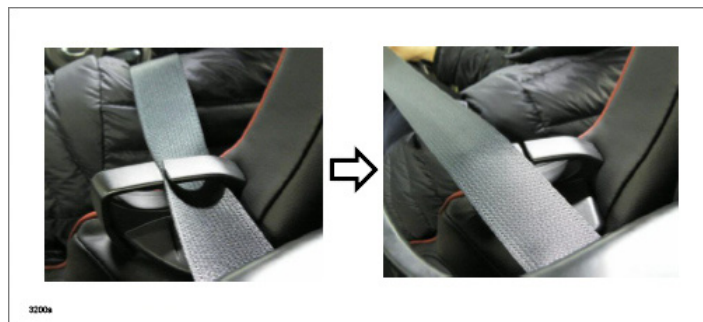

To correct the problem, the shape of the seat belt guide has been changed.

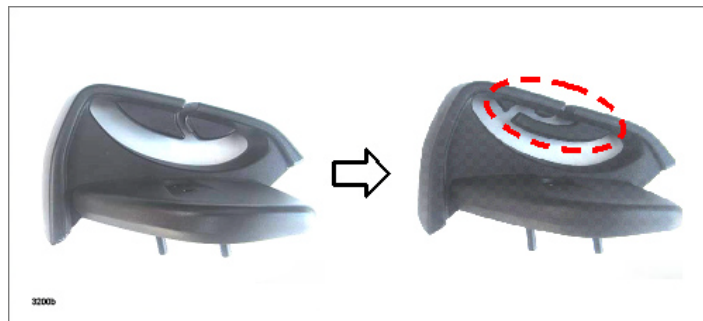

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Remove two philips head screws on the seat belt guide, then replace the seat belt guide with a modified one (both sides).
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
N243-88-1M7-02	Guide (L), Belt-Seat	1	Left side
N243-88-1L7-02	Guide (R), Belt-Seat	1	Right side

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty.
- Additional diagnostic time cannot be claimed for this repair.
- **This TSB can be performed by D329 Mazda Certified Lube Technicians.**

Warranty Type	A
Symptom Code	74 (Poor maneuverability)
Damage Code	97 (Improper clearance)
Part Number Main Cause / Qty.	N243-88-1M7-02 / 1
Related Part Number / Qty.	N243-88-1L7-02 / 1
Operation Number / Labor Hours:	XXM3JXRX / 0.2 Hrs.
TSB can be performed by D329 Mazda Certified Lube Technicians:	Yes